


AUTODATA TECHNICAL

Autodata, UK supplier of technical information to the automotive aftermarket, shares fixes and problems raised through its technical helpline, available to all UK customers.

Q We are having trouble diagnosing a water ingress on a 2011 Nissan Micra. The front footwell carpets are wet after heavy rain. We have carried out several water tests but cannot see how the water is entering the vehicle. Have you got any advice for us?

A Yes, we are aware of this fault and the cause is water ingress through the bulkhead bodywork joints due to insufficient quantity of sealant.

Remove the side trim panels in RH and LH footwells. Inspect the bodywork joint in LH footwell. Apply sealant to bodywork joint in the affected area (Fig 1.1). Inspect the bodywork joint in RH footwell. Apply sealant to bodywork joint in the affected area (Fig 1.2). Dry out carpets as necessary.

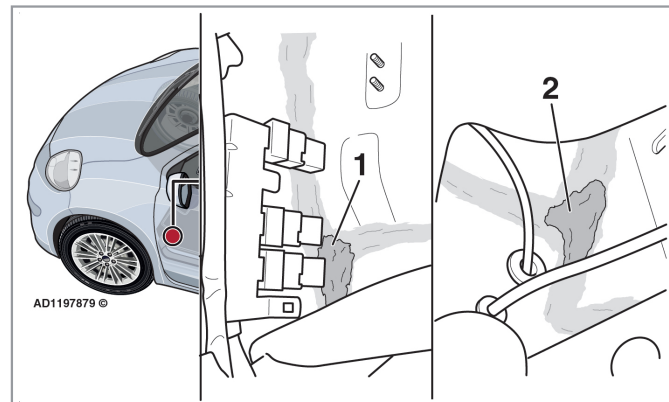

For further information on our exclusive RMI and Autodata joint membership offer, please contact the RMI member helpline on 01788 225 908.